



- **Montagehinweise für Aufsteckgetriebe mit Schrumpfscheibe**
- **Assembly notes for shaft mounted gear units with shrink disc**
- **Instructions de montage pour réducteurs à arbre creux avec frette de serrage**

1.

2.

3.

4.

5.

		Nm	max.
KH 19/29 FH 27 SH 37 WH 29/37/39	M5	5	60°
KH 39/49/37-77 FH 37-77 SH 47-77 WH 47/49/59	M6	12	
KH 87/97 FH 87/97 SH 87/97	M8	30	
KH 107 FH 107	M10	59	
KH 127/157 FH 127/157	M12	100	
KH 167	M16	250	
KH187	M20	470	


31559425/DE – 01/2024

9007241690826251




- **Montagehinweise für Aufsteckgetriebe mit Passfederverbindung**
- **Assembly notes for shaft mounted gear units with keyed connection**
- **Instructions de montage pour réducteurs à arbre creux avec liaison par clavette**


1.

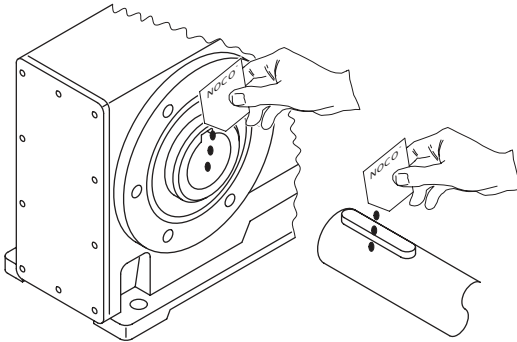


2.

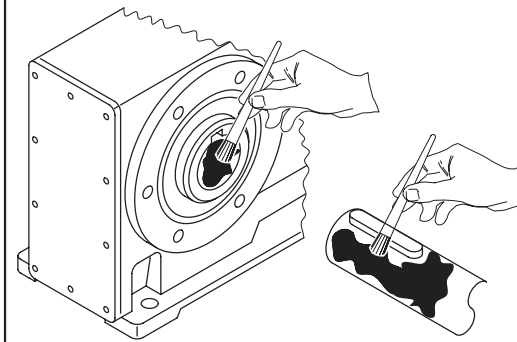

3.

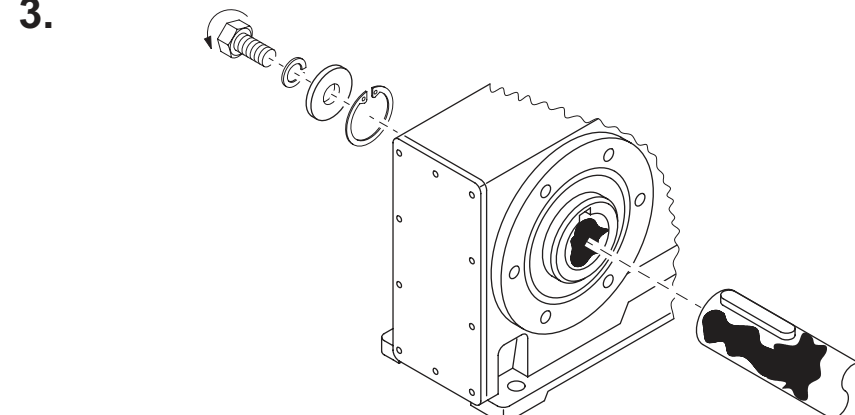

4.

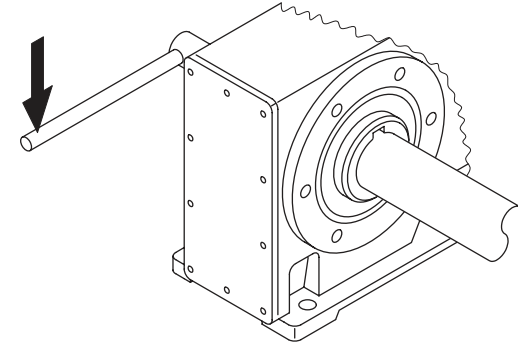

	Nm
M5	5
M6	8
M10/M12	20
M16	40
M20	80
M24	200

31559425/DE – 01/2024

9007241690823819